

TECHNICAL SERVICE POINTER

For Immediate Attention of Your Service Department

Technical Service Pointer: W11282589

Action Required: Information

Publication Date: July 2018

Brands Affected



COMMERCIAL LAUNDRY

Air Dome Pressure Sensor Pulling Loose / Cracking

Models

MHN33	CHW9150 / 9160
MHN30	CET9000 / 9100
MLE / MLG22	CGT9000 / 9100
MLE / MLG20	

Description

During some severe unbalance occurrences, the hose attached to the pressure sensor may chafe where it is zip tied to the machine (MHN30 and MLE / MLG20). On other machines, the hose may pull off of or crack the nipple of the pressure transducer (MHN33 and MLE / MLG22).

Production Correction

The hose has been lengthened by approximately 7 inches and is now routed through the internal, grey clip on the back, right corner of the cabinet. This entered production with serial number C81660000 in late April. The new hose can be ordered as a service part (W11252474).



QUESTIONS?

Please contact your Customer Relations Manager.

ALL POINTERS ONLINE:

www.serviceconnections.org/

® Registered trademark of Whirlpool, U.S.A., KitchenAid, U.S.A., Jenn-Air, U.S.A., or Maytag Properties, LLC or its related companies.

®MAGIC CHEF is a registered trademark of CNA International, used under license. © 2016 All rights reserved.